

Dowry

#03210

4RSPH $\frac{w}{65}$ AH

Lenco Manufacturing Order Form

Customer Name Downey Farms
 Address: Shelburne ont
 Phone Number: 519-925-6294
 Fax Number: 519-925-3520

Downey Farms
 2003

Chain:							
Location	Qty	Rod Size	Width	MM	LPR	Pattern	Covering
PRIMARY	4	0.50	33	50	109	2DN1ST	PLAIN
SECONDARY	2	0.44	68	45	68	ST	SRT
DEVINER	2	0.62	68	150	64	ST	SRT
CROSS	1	0.44	48	45	217	ST	SRT
LOWER SIDE ELEVATOR	1	0.44	65	45	325	ST	SRT
UPPER SIDE ELEVATOR	1	0.44	65	45	284	ST	SRT
BIN FEED	1	0.44	35	45	230	ST	SRT
BIN UNLOAD	1	BELT	40		26 ft		
BULKLOADER	1	0.44	35	45	179	ST	SRT
STONE	1	0.44	14	28	470	ST	PLAIN
Location	Qty	Rod Size	Width	MM	LPR	Pattern	Covering


Primary - 18'
 Secondary - 10'
 Deviner - 32'
 BULKLOADER - 26 1/2'
 Hopper - 26'
 Sort - 34'
 Lower Side 48'
 Upper Side 42'
 Stone 43'
 Cross 32'

MANUFACTURING ORDER FORM CHANGES

CUSTOMER DOWNEY FARMS
MACHINE 4 ROW 65" AIR HEAD
SERIAL NO 3210
DATE 2/18/2003

ASKED FOR BY ED OK BY RANDAL

- CHANGES
- 1 INSTALL PRECLEANER ON THE RADIATOR FROM JOHN DEERE
 - 2 PIVOT BOLTS FOR BLADE DRILL OUT TO .75 DIA
 - 3 ADD 2 INCH ROLLER TO VINE BELT TO KEEP POTATOES THAT WOULD GET PULLED OUT AS DRAWN BELOW

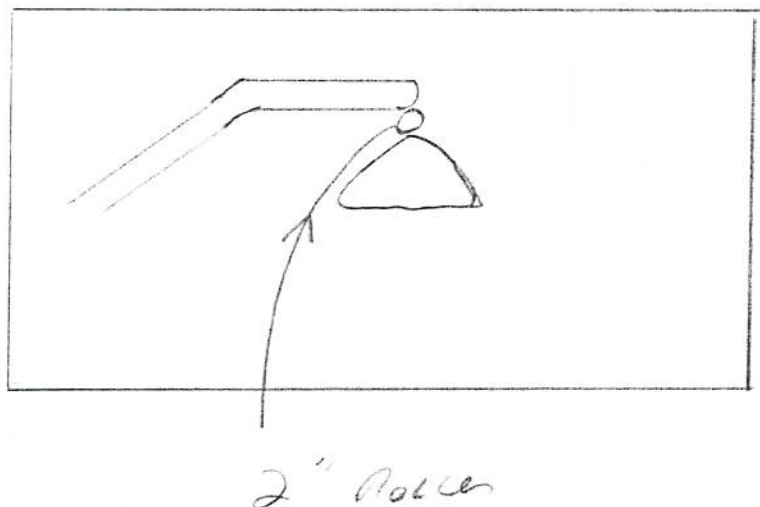

Lenco Products Inc.
5773 Crystal Rd.
Vestaburg, MI 48891
Phone: (989) 268-5083
Fax: (989) 268-5820

Machine: _ALL_

Document #: 93

Customer: _DOWNEY

Date: _8-3-03_

Problem:
WITH SPLIT ROCKSHAFT BREAKS THE SLIP JOINT


Correction:


I AM NOT SURE IT IS EVEN NEEDED SIDE THAT IS LOWER
SEEMS TO COME UPFIRST AND THAN EQUALS WITH THE
OTHER SIDE

1. One Time Fix: _____

2. Change On All Machine: _____

3. Assembled Wrong: _____

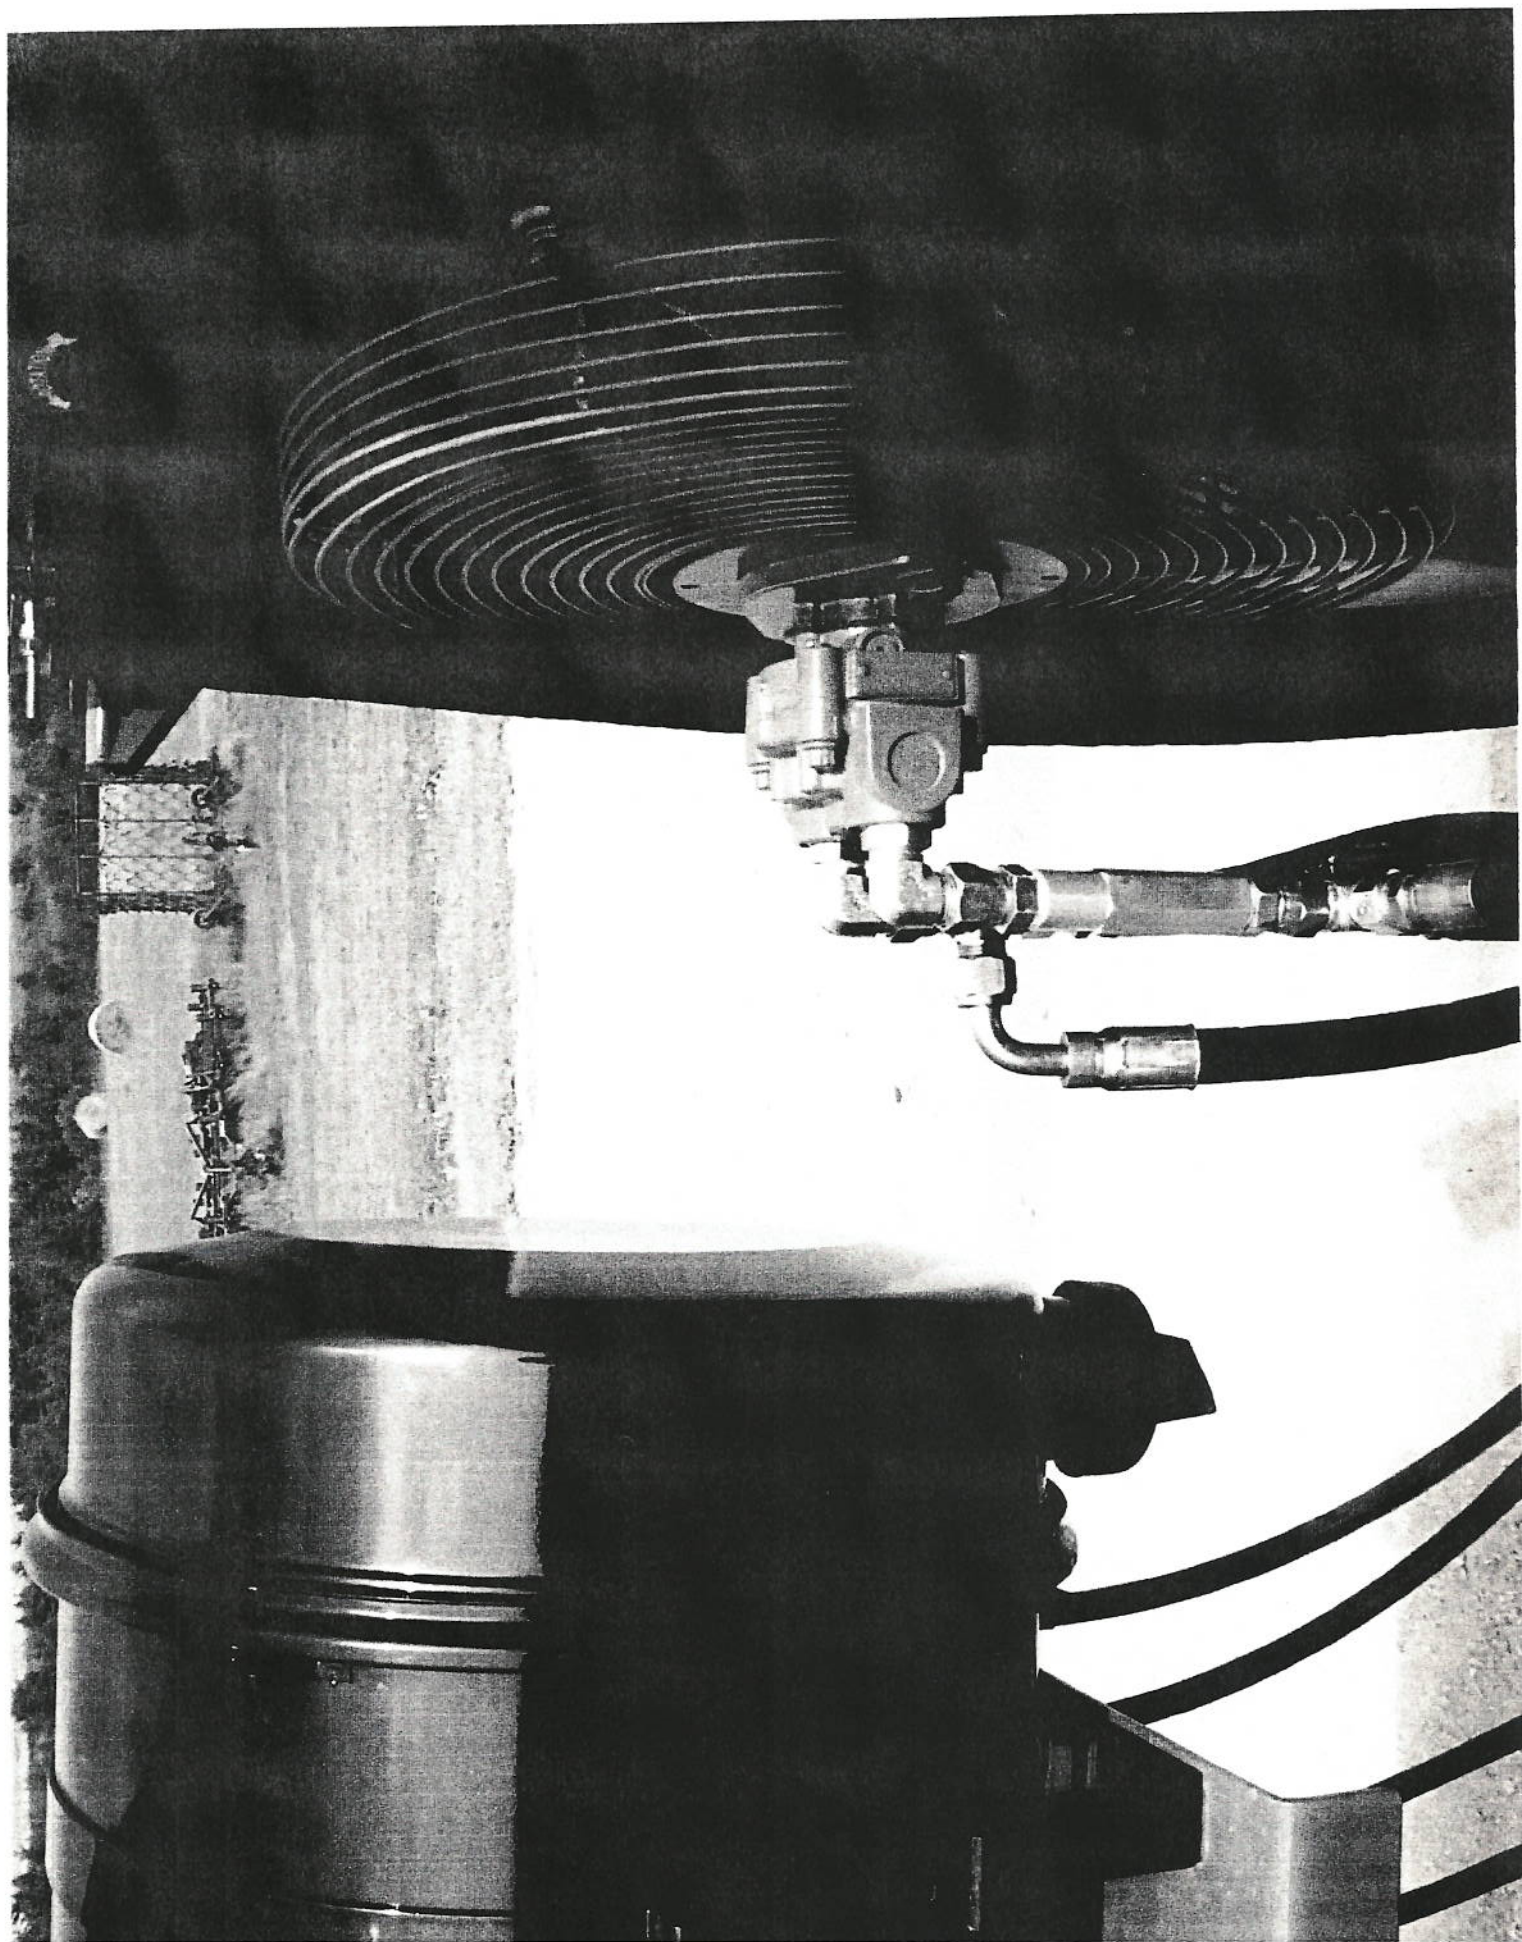

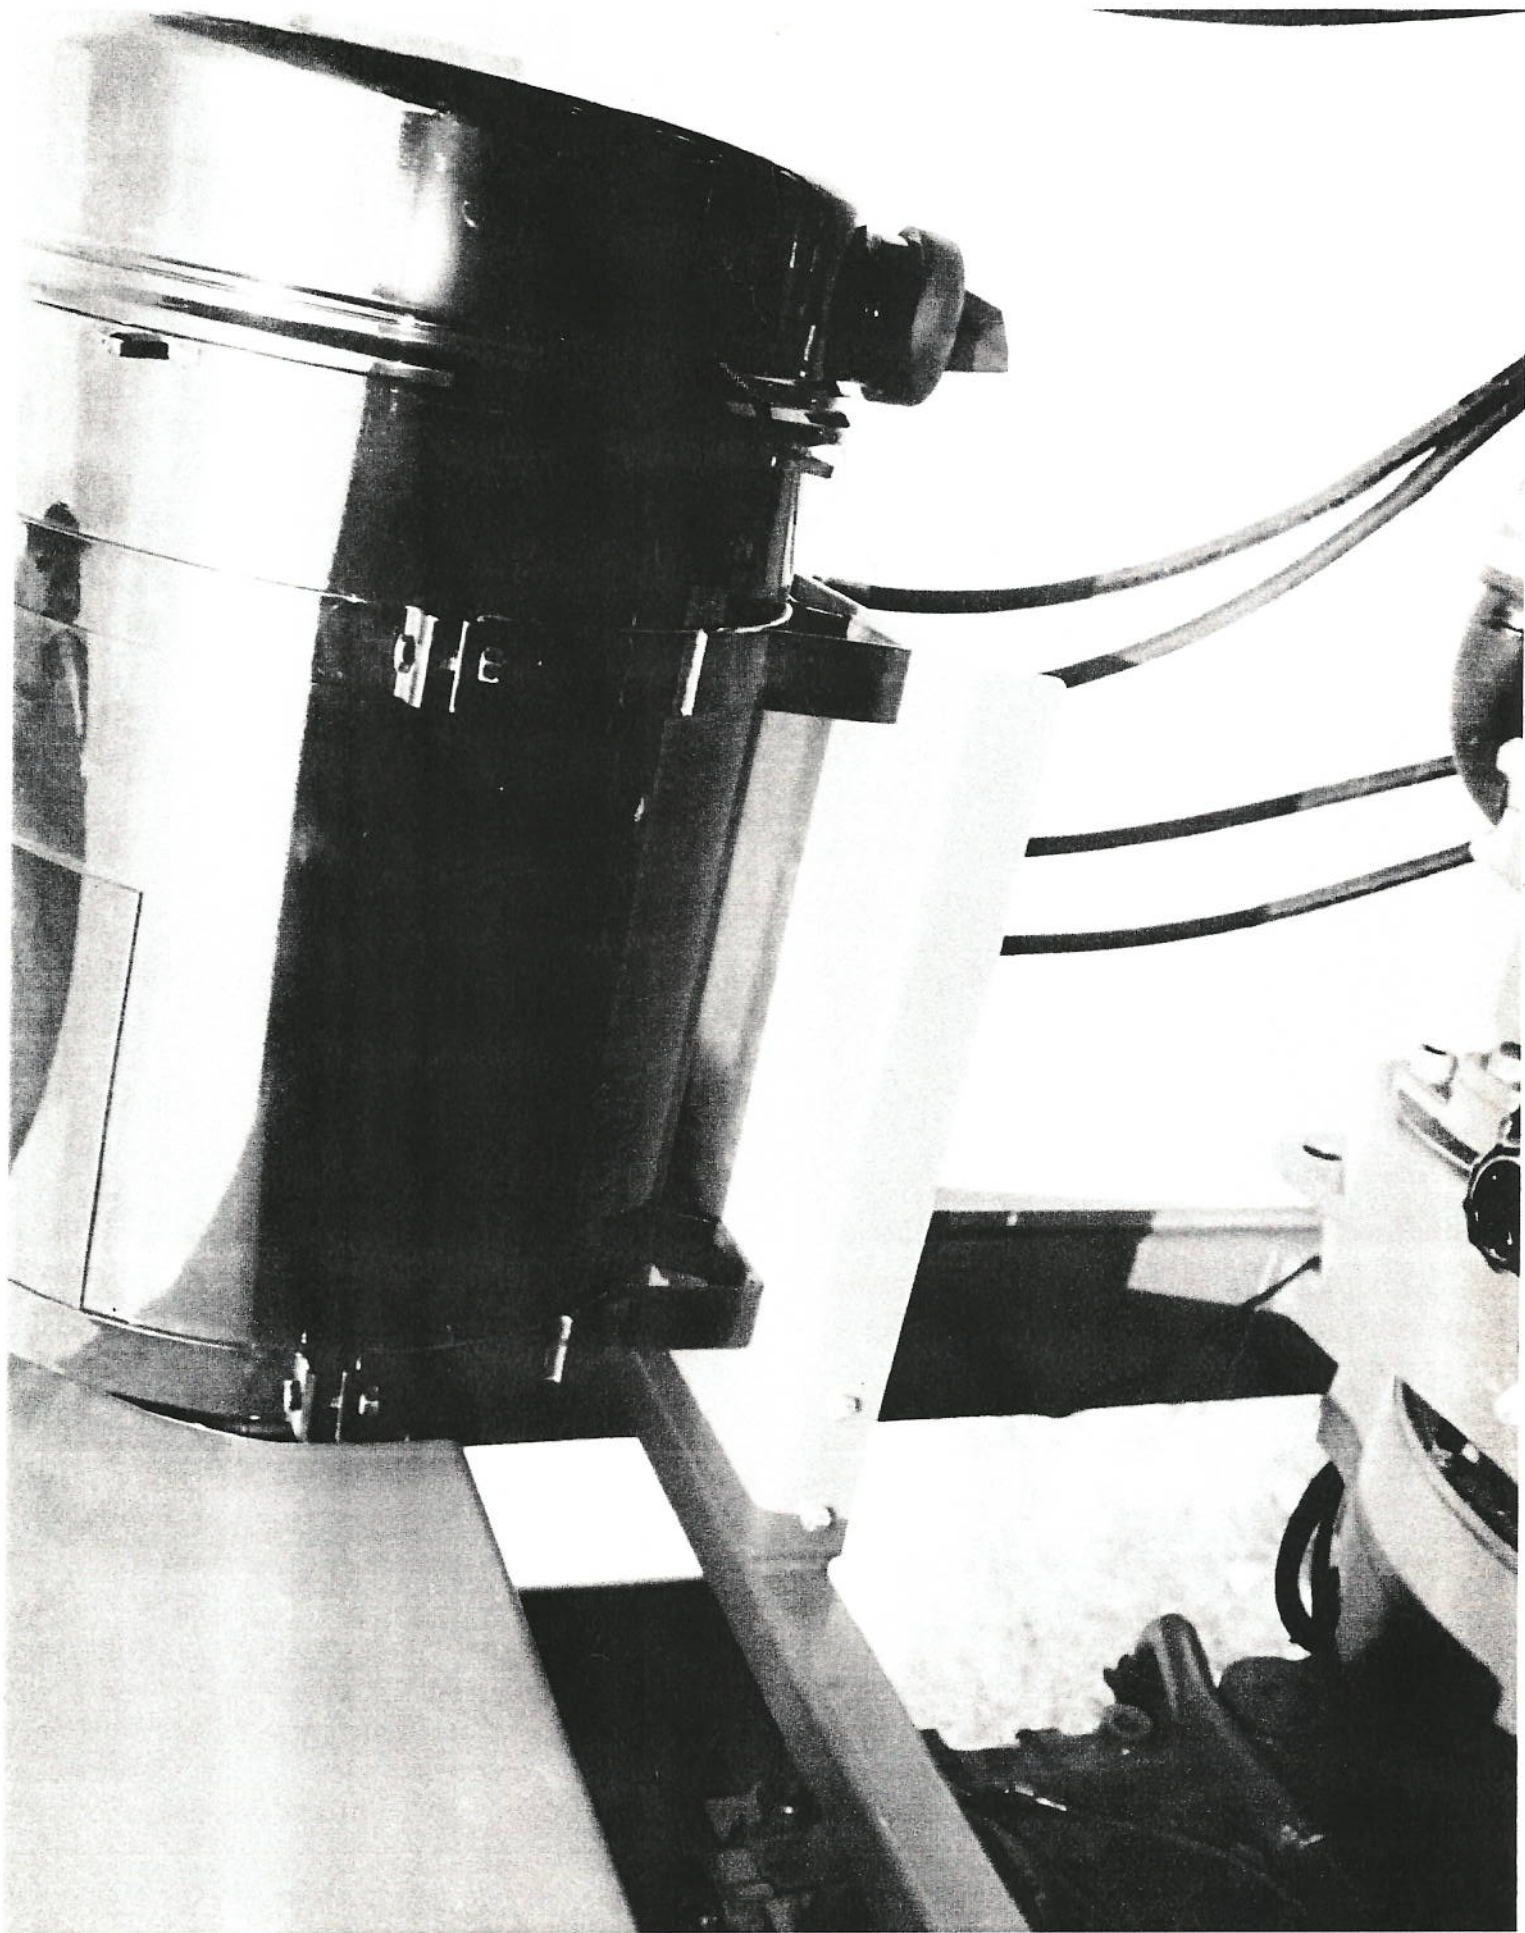

Lenco Products Inc.
5773 Crystal Rd.
Vestaburg, MI 48891
Phone: (989) 268-5083
Fax: (989) 268-5820

Machine: _ALL_

Document #: 92

Customer: _DOWNEY

Date: _8-3-03_

Problem:

AIR CLEANER MOUNTED TO CLOSE TO OIL COOLER CANNOT
REMOVE THE FILTER OR EVEN THE CAP


Correction:

MOVE ALL AIR CLEANERS TO A SIDE MOUNT 90 DEGREES TO
THE HOOD

1. One Time Fix: _____

2. Change On All Machine: _____

3. Assembled Wrong: _____

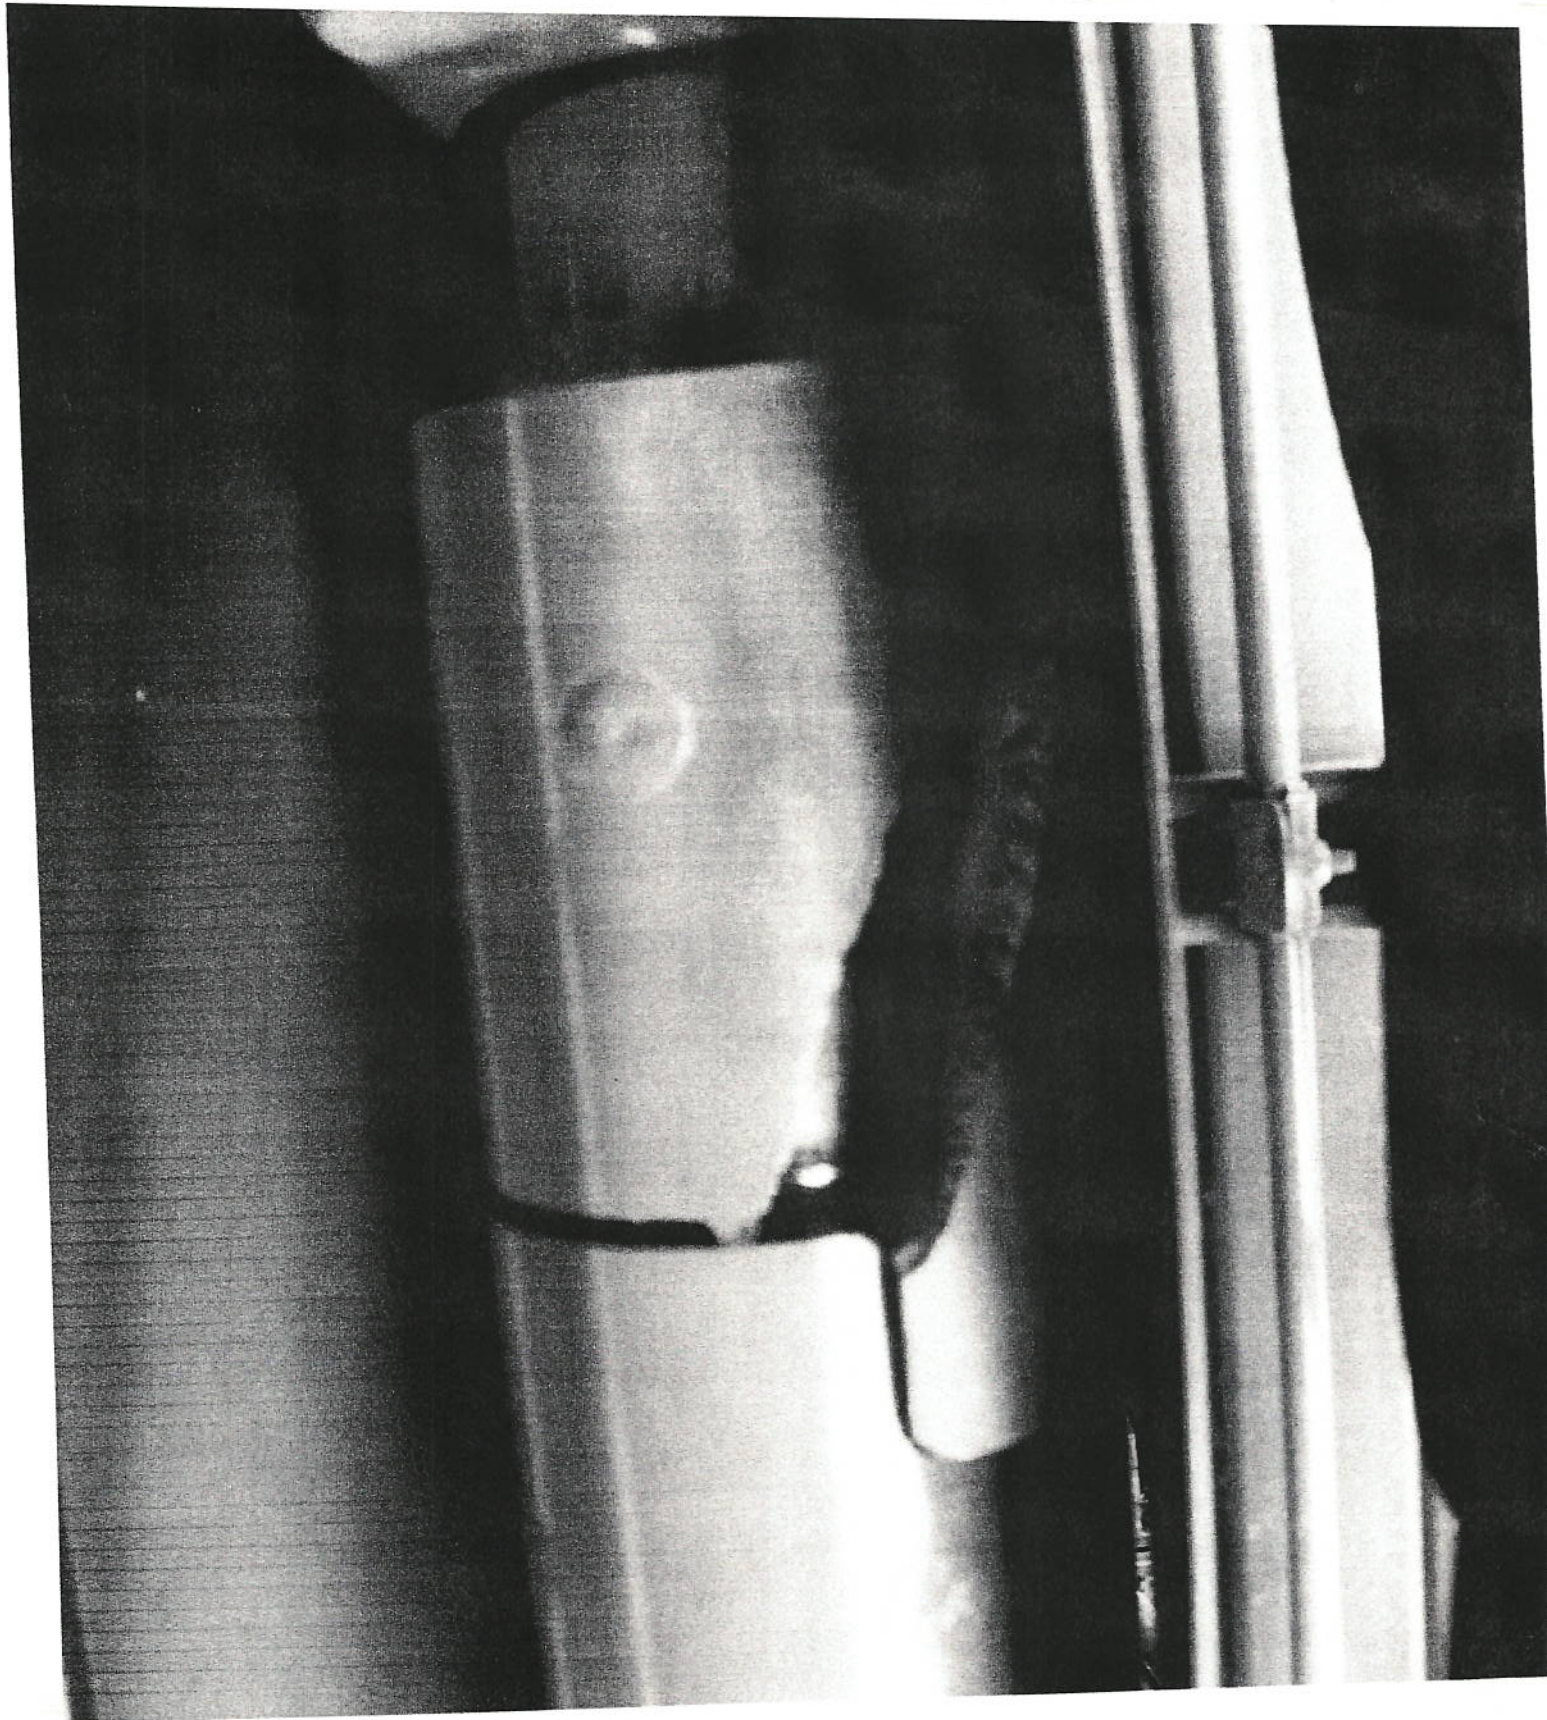

11/11/2003
10:53 AM

Page 14 / 24

Downey 03210

Lenco Products Inc
Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
8/22/2003 721111	Wire Terminal (Box of 100)		3.0000		.25			
8/22/2003 76410	90 AMP Breaker		3.0000		91.69			
8/22/2003 723205	Wire Terminals (Box of 25)		18.0000		3.14			
8/22/2003 WJ96	90 Latch For Shields		1.0000		1.97			
8/22/2003 T G6126	Toggle Switch		1.0000		7.38			
8/22/2003 T G6143	Toggle Switch		1.0000		12.45			
8/22/2003 T G6261	Toggle Switch		2.0000		13.80			
8/22/2003 TGA-10	Snap In Light		2.0000		6.74			
8/22/2003 85946	DS115 Wire Socket		1.0000		1.81			
8/22/2003 30009-014	Distribution Panel Timer Brack		1.0000		9.11			
8/22/2003 THHN-06	6AWG		82.0000		14.07			
8/22/2003 XM-6C-200R/HR	10 Amp Brake Pressure Switch		1.0000		61.91			
8/22/2003 194	Bulb		1.0000		.32			
8/22/2003 601	Red Pedestal Flasher		1.0000		34.75			
8/22/2003 04523	Round Work Lights (32pcs/cas		12.0000		83.88			
8/22/2003 6500	Flush Mount Red Flasher		2.0000		53.53			
8/22/2003 THHN-08	8AWG		15.0000		1.68			
8/22/2003 TS-6642	Engine Temperature Switch		1.0000		4.00			
8/29/2003 783562/95299	16 awg 25 Conductor Wire		38.0000		44.35			
8/29/2003 A20R166HCR	Harvester Enclosure(783510/386		1.0000		105.18			
8/29/2003 A1210CH	Enclosure		1.0000		52.23			
8/29/2003 783562/95121	8488 BELDEN Wire		50.0000		41.43			
8/29/2003 852-5X	Flasher		2.0000		24.50			
8/29/2003 20003-001	Actuator 3" stroke (SPO 5072)		2.0000		421.30			
8/29/2003 97891	HOU 8771 Shielded Cable 22 Ga		40.0000		6.12			
8/29/2003 20024-001	Receptacle (HD 44-24-31 PN)		1.0000		31.30			
8/29/2003 20026-001	Plug (HD 46-24-31 SN-059)		1.0000		50.01			
8/29/2003 8774AV	Unplated Brass Terminal		2.0000		.36			
8/29/2003 1786	1/2" Split Poly 250 FT Box		80.0000		16.01			
8/29/2003 1784	3/8" Split Poly 250 FT Box		120.0000		20.06			
8/29/2003 1930	1" Split Poly 350 FT Box		15.0000		2.57			
8/29/2003 1929	3/4" Split Poly 600 FT Box		50.0000		8.46			

Category/Class Total:

4,367.0300

.0000

5,885.00

.00

5,885.00

MA-HYD Hydraulic Materials

Materials

6/18/2003 40000-003

Gauge Panel Side Plates Assemb

1.0000

51.15

7/16/2003 872FS 06

3/8" JIC x 3/8" JIC Swivel Te

2.0000

8.04

7/16/2003 846FS 06x08

3/8" JIC x 1/2" NPT

1.0000

1.02

7/16/2003 846FSO 08x06

1/2" JIC x 3/8" Oring

27.0000

32.94

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
7/16/2003 848FSO 06x08	3/8" JIC x 1/2" Oring		20.0000		17.60			
7/16/2003 848FSO 06x06	3/8" JIC x 3/8" Oring		15.0000		9.30			
7/16/2003 848FS 06x04	3/8" JIC x 1/4" NPT		9.0000		3.42			
7/16/2003 848FS 16x12	1" JIC x 3/4" NPT		1.0000		2.04			
7/16/2003 848FS 12x12	3/4" JIC x 3/4" NPT		12.0000		15.84			
7/16/2003 848FS 08x08	1/2" JIC x 1/2" NPT		11.0000		13.19			
7/16/2003 721FSO 12	3/4" Oring Plug		13.0000		17.55			
7/16/2003 848FS 08x06	1/2" JIC x 3/8" NPT		3.0000		2.01			
7/16/2003 848FSO 08x12	1/2" JIC x 3/4" Oring		26.0000		52.26			
7/16/2003 848FS 06x06	3/8" JIC x 3/8" NPT		2.0000		1.16			
7/16/2003 848FS 06x04	3/8" JIC x 1/4" NPT		18.0000		6.84			
7/16/2003 848FS 06x02	3/8" JIC x 1/8" NPT		5.0000		3.72			
7/16/2003 841FS 20	1 1/4" JIC Nut		1.0000		2.51			
7/16/2003 841FS 16	1" JIC Nut		4.0000		5.03			
7/16/2003 841FS 12	3/4" JIC Nut		12.0000		6.37			
7/16/2003 841FS 08	1/2" JIC Nut		1.0000		.23			
7/16/2003 7400 12-27	3/4" JIC x 27mm Metric Fitting		4.0000		152.78			
7/16/2003 848FS 08x12	1/2" JIC x 3/4" NPT		2.0000		3.36			
7/16/2003 849FSO 06x06	3/8" JIC x 3/8" Oring 90		11.0000		28.93			
7/16/2003 3123	Fuel Filter		1.0000		10.98			
7/16/2003 871FS 16	1" JIC x 1" JIC Swivel Tee		2.0000		18.57			
7/16/2003 871FS 12	3/4" JIC x 3/4" JIC Swivel Tee		15.0000		118.50			
7/16/2003 871FS 08	1/2" JIC x 1/2" JIC Swivel Tee		9.0000		26.82			
7/16/2003 871FS 06	3/8" JIC x 3/8" JIC Swivel Tee		9.0000		30.60			
7/16/2003 851FSO 12	3/4" JIC x 3/4" Oring Tee		5.0000		30.70			
7/16/2003 849FSO 12x12	3/4" JIC x 3/4" Oring 90		2.0000		10.08			
7/16/2003 849FSO 10x10	5/8" JIC x 5/8" Oring		1.0000		2.98			
7/16/2003 848FSO 08x08	1/2" JIC x 1/2" Oring		32.0000		42.86			
7/16/2003 849FS 06x08	3/8" JIC x 1/2" NPT 90		3.0000		5.58			
7/16/2003 848FSO 08x10	1/2" JIC x 5/8" Oring		5.0000		7.08			
7/16/2003 848FSO 20x20	1 1/4" JIC x 1 1/4" Oring		1.0000		5.41			
7/16/2003 848FSO 16x20	1" JIC x 1 1/4" Oring		7.0000		38.92			
7/16/2003 848FSO 16x16	1" JIC x 1" Oring		10.0000		22.10			
7/16/2003 848FSO 16x12	1" JIC x 3/4" Oring		1.0000		2.62			
7/16/2003 848FSO 12x16	3/4" JIC x 1" Oring		16.0000		37.12			
7/16/2003 848FSO 12x12	3/4" JIC x 3/4" Oring		71.0000		122.82			
7/16/2003 848FSO 12 x 10	3/4" JIC x 5/8" Oring		21.0000		41.37			
7/16/2003 844FS 08	1/2" JIC 3way Male Tee		1.0000		2.53			
7/16/2003 849FSO 08x08	1/2" JIC x 1/2" Oring		11.0000		25.50			

11/11/2003

10:53 AM

Lenco Products Inc
Management Detail

Page 16 / 24

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
7/16/2003 BK132	2" CLS Nipple Black Pipe		13.0000		33.67			
7/16/2003 25VJ 08	1/2" NPT Hydraulic Female Tee		1.0000		3.72			
7/16/2003 25VJ 04	1/4" NPT Hydraulic Female Tee		1.0000		2.05			
7/16/2003 25UG 08	1/2" NPT Hydraulic 90 ST. EL.		1.0000		2.79			
7/16/2003 25UG 04	1/4" NPT Hydraulic 90 St. El		1.0000		1.11			
7/16/2003 24SJ 04	1/4" NPT Hydraulic Coupler		17.0000		11.12			
7/16/2003 BK31632	1" x 2" Bushing Black Pipe		2.0000		3.52			
7/16/2003 24SA 12X08	3/4" x 1/2" NPT Hydraulic Nipp		2.0000		3.92			
7/16/2003 3269 04-04	1/4" NPT x 1/4" Oring Adapter		1.0000		1.96			
7/16/2003 BK32432	1 1/2" x 2" Bushing Black Pipe		3.0000		8.79			
7/16/2003 BK32032	1 1/4" x 2" Bushing		8.0000		23.14			
7/16/2003 BK432	2" 90 ST EL. Black Pipe		8.0000		58.08			
7/16/2003 BK140	2 1/2" CLS Nipple Black Pipe		1.0000		7.83			
7/16/2003 1303-1.6	1.6 GPM Vonberg Flow Control (		2.0000		44.38			
7/16/2003 5E434	1/2" Gas ball Valve		2.0000		9.78			
7/16/2003 6065W	Fuel Pump		1.0000		78.35			
7/16/2003 721FSO 08	1/2" Oring Plug		8.0000		5.84			
7/16/2003 848FSO 12X20	3/4" JIC x 1 1/4" Oring		2.0000		10.77			
7/16/2003 4309	Fuel Filter Base		1.0000		22.30			
7/16/2003 24SA 04	1/4" NPT Hydraulic Nipple		1.0000		.37			
7/16/2003 63UA 16x16	1" JIC 90 Sweep		3.0000		37.14			
7/16/2003 6402 12-12	3/4" Oring x 3/4" JIC female		3.0000		13.68			
7/16/2003 6403 NWO 12-08	3/4" Oring x 1/2" Oring		4.0000		86.22			
7/16/2003 6402 08-08	1/2" Oring x 1/2" JIC Female		4.0000		7.36			
7/16/2003 BK832	2" Tee Black Pipe		6.0000		48.96			
7/16/2003 20003-004	High Pressure Filter		3.0000		1,997.61			
7/16/2003 6402 08-06	1/2" Oring x 3/8" JIC Female		1.0000		5.81			
7/16/2003 63TA 08X08	1/2" JIC 45 Sweep		16.0000		104.32			
7/16/2003 63TA 06X06	3/8" JIC 45 Sweep		6.0000		29.70			
7/16/2003 63UC 12X12	3/4" JIC 90 Sweep		17.0000		222.02			
7/16/2003 63UA 12X12	3/4" JIC 90 Sweep		93.0000		924.25			
7/16/2003 602-S7	Gauge Snubber		18.0000		99.14			
7/16/2003 63UA 06X06	3/8" JIC 90 Sweep		16.0000		129.11			
7/16/2003 63SF 16x16	1" male JIC x 1" Flange		2.0000		25.46			
7/16/2003 63SF 12x12	3/4" Male JIC x 3/4" Flange		5.0000		88.34			
7/16/2003 63SE 16x16	1" Male JIC x 1" Flange		6.0000		61.92			
7/16/2003 31FWM	3 inch Flexwrap Magnet		6.0000		51.60			
7/16/2003 63UA 06X08	1/2" JIC 90 Sweep		38.0000		253.04			
7/16/2003 41FWM	4 In Flex Wrap Magnet		2.0000		14.40			

10:53 AM

Lenco Products Inc
Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
7/16/2003	63UE 16x16	1" male JIC x 1" Flange 90	2.0000		30.74			
7/16/2003	BK34864	3" x 4" Bushing	1.0000		9.92			
7/17/2003	U320	1 1/4" Suction Hose	20.8300		80.82			
7/17/2003	U332	2" Suction Hose (GY=C232)	21.0800		190.99			
7/17/2003	N316	1" High Pressure Hydraulic Hos	90.8300		685.23			
7/17/2003	HTB16	1" High Pressure Hose	3.0800		16.94			
7/17/2003	BW08x08FJ90T	1/2" Hose x 1/2" JIC 90 Hose E	1.0000		4.95			
7/17/2003	872FS 08	1/2" JIC x 1/2" JIC Swivel Tee	3.0000		8.92			
7/17/2003	BW08x08FJ	1/2" Hose x 1/2" JIC Hose End	35.0000		88.68			
7/17/2003	BW12x12FJ	3/4" Hose x 3/4" JIC Hose End	106.0000		438.90			
7/17/2003	BW12x12FJ	3/4" Hose x 3/4" JIC Hose End	20.0000		82.81			
7/17/2003	BXP04	1/4" Hydraulic Hose	4.5800		5.47			
7/17/2003	BW04x06FJ	1/4" Hose x 3/8" JIC Hose End	2.0000		3.74			
7/17/2003	HL16x16FJ	1" High Pressure Hose End	2.0000		18.36			
7/17/2003	BW08x08FJ90T	1/2" Hose x 1/2" JIC 90 Hose E	1.0000		4.95			
7/17/2003	BW08x08FJ	1/2" Hose x 1/2" JIC Hose End	5.0000		12.67			
7/17/2003	BXP08	1/2" Hydraulic Hose	15.4200		26.21			
7/17/2003	BXP12	3/4" Hydraulic Hose	207.3300		523.20			
7/17/2003	BW12x12FJ	3/4" Hose x 3/4" JIC Hose End	86.0000		356.09			
7/17/2003	BXP12	3/4" Hydraulic Hose	228.2500		575.99			
7/17/2003	N312	3/4" High Pressure Hydraulic H	48.3300		295.21			
7/17/2003	BXP12	3/4" Hydraulic Hose	36.1700		91.27			
7/17/2003	BW06x06FJ	3/8" Hose x 3/8" JIC Hose End	14.0000		29.27			
7/17/2003	BW06x06FJ90T	3/8" Hose x 3/8" JIC 90 Hose E	11.0000		47.59			
7/17/2003	BW04x06FJ	1/4" Hose x 3/8" JIC Hose End	14.0000		26.19			
7/17/2003	BXP04	1/4" Hydraulic Hose	43.8300		52.37			
7/17/2003	JJ12x12FJ	3/4" High Pressure Hose End	24.0000		225.77			
7/17/2003	BW06x06FJ90T	3/8" Hose x 3/8" JIC 90 Hose E	3.0000		12.98			
7/17/2003	JJ16x16FJ	1" High Pressure Hose End	32.0000		325.95			
7/17/2003	011112	Paraflex Element	1.0000		98.30			
7/17/2003	BW04x06FJ90T	1/4" Hose x 3/8" JIC 90 Hose E	12.0000		83.58			
7/17/2003	BW04x06FJ	1/4" Hose x 3/8" JIC Hose End	47.0000		87.91			
7/17/2003	BXP04	1/4" Hydraulic Hose	137.1700		163.89			
7/17/2003	BW06x06FJ	3/8" Hose x 3/8" JIC Hose End	11.0000		23.00			
7/17/2003	BW08x08FJ90T	1/2" Hose x 1/2" JIC 90 Hose E	7.0000		34.68			
7/17/2003	BW08x08FJ	1/2" Hose x 1/2" JIC Hose End	19.0000		48.14			
7/17/2003	BXP06	3/8" Hydraulic Hose	100.5000		272.50			
7/17/2003	BXP08	1/2" Hydraulic Hose	66.4200		112.88			
7/17/2003	BW06x08FJ	3/8" Hose x 1/2" JIC Hose End	17.0000		43.42			

10:53 AM

Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
7/17/2003	BW/08x08FJ90T	1/2" Hose x 1/2" JIC 90 Hose E	16.0000		79.27			
7/17/2003	BW/06x08FJ	3/8" Hose x 1/2" JIC Hose End	4.0000		10.22			
7/17/2003	BW/08x08FJ	1/2" Hose x 1/2" JIC Hose End	40.0000		101.35			
7/17/2003	BW/06x06FJ	3/8" Hose x 3/8" JIC Hose End	24.0000		50.18			
7/17/2003	BW/06x08FJ	3/8" Hose x 1/2" JIC Hose End	12.0000		30.65			
7/17/2003	BXP16	1" Hydraulic Hose	9.0000		31.43			
7/17/2003	BXP08	1/2" Hydraulic Hose	140.7500		239.20			
7/17/2003	BXP06	3/8" Hydraulic Hose	77.7500		210.81			
7/17/2003	BXP04	1/4" Hydraulic Hose	15.0800		18.02			
7/17/2003	BXP06	3/8" Hydraulic Hose	30.0000		81.34			
7/17/2003	BXP08	1/2" Hydraulic Hose	55.0800		93.61			
7/17/2003	BW/04x06FJ	1/4" Hose x 3/8" JIC Hose End	12.0000		22.45			
7/17/2003	BW/06x06FJ90T	3/8" Hose x 3/8" JIC 90 Hose E	6.0000		25.96			
7/17/2003	BW/16x16FJ	1" Hose x 1" JIC Hose End	2.0000		13.88			
7/17/2003	HFP-1843	1/2" NPT Breather	1.0000		8.83			
7/17/2003	FT-150	1 1/2" Hose Barb	1.0000		3.32			
7/17/2003	FT-125	1 1/4" Hose Barb	8.0000		17.52			
7/17/2003	FT-100	1" Hose Barb	2.0000		3.23			
7/17/2003	DTS-2455	1" Split Flange (Use with "E")	6.0000		37.67			
7/17/2003	DTS-2349	1" Split Flange (Use w/ "F")	1.0000		13.72			
7/17/2003	DGA20-1/4NPT	Test Point Fitting	1.0000		12.50			
7/17/2003	20010-014	Pressure Gauge 0-10000 PSI	2.0000		12.80			
7/17/2003	20009-014	Pressure Gauge 0-5000 PSI	3.0000		31.29			
7/17/2003	20008-014	Pressure Gauge 0-3000 PSI	7.0000		69.80			
7/17/2003	20007-014	Pressure Gauge 0-600 PSI	5.0000		57.00			
7/17/2003	FT-200	2" Hose Barb	2.0000		6.10			
7/17/2003	BF12	3/4" NPT Breather	1.0000		7.18			
7/17/2003	883FS 12x06	3/4" x 3/8" JIC Reducer	5.0000		11.09			
7/17/2003	883FS 20x16	1 1/4" x 1" JIC Reducer	1.0000		6.34			
7/17/2003	883FS 16x12	1" x 3/4" JIC Reducer	4.0000		21.37			
7/17/2003	883FS 12x08	3/4" x 1/2" JIC Reducer	15.0000		49.04			
7/17/2003	883FS 10x08	5/8" x 1/2" JIC Reducer	19.0000		28.31			
7/17/2003	6505 08-06	1/2" NPT x 3/8" JIC female	4.0000		9.20			
7/17/2003	881FS 08x08	1/2" NPT x 1/2" Female JIC	4.0000		19.22			
7/17/2003	6505 06-06	3/8" NPT x 3/8" JIC female	1.0000		1.69			
7/17/2003	872FS 12	3/4" JIC x 3/4" JIC Swivel Tee	1.0000		10.58			
7/17/2003	25180-018	1 1/4" Bore Coupler Sprocket	2.0000		31.28			
7/17/2003	Y912	Fuel Line Hose	18.7500		62.83			
7/17/2003	30037-019	Hydraulic Bypass Tube	1.0000		7.32			

10:53 AM

Lenco Products Inc Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
7/11/2003	Z63UC 16x16	90 Sweep	7.0000		165.56			
7/11/2003	883FS 08x06	1/2" x 3/8" JIC Reducer	1.0000		.76			
7/11/2003	FT-250	2 1/2" Hose Barb	1.0000		6.70			
7/11/2003	21019-018	3020-1 3/4 Taper Lock Bushing	1.0000		16.80			
7/11/2003	21018-018	3020 3" Taperlock Bushing	1.0000		16.80			
7/11/2003	20012-004	Double Filter Head	1.0000		49.98			
7/11/2003	Z63UA 16x16	1" High Pressure Sweep	11.0000		222.42			
7/11/2003	010608	PX120 Parallel Flange	2.0000		302.28			
7/11/2003	Z63UA 12x12	High Pressure Sweep	5.0000		44.43			
7/11/2003	W43-32PK	2" NPT Flange Adapter	2.0000		46.58			
7/11/2003	VS-01-1-3-1	Timer Valve Subplate	1.0000		20.25			
7/11/2003	V500P-32	2" Ball Valve	8.0000		216.47			
7/11/2003	20014-004	Intank Strainer	1.0000		36.82			
7/11/2003	PF800S	1/2" Needle Valve w/Check	2.0000		36.96			
7/11/2003	G615-8A1	Oil Tank Sight Gauge	1.0000		32.72			
7/11/2003	OM-1620-90	1" oring x 1 1/4" Suction fitt	4.0000		59.56			
7/11/2003	LT-50	Gresen Check Valve	1.0000		14.29			
7/11/2003	20013-004	Intank Strainer	3.0000		89.24			
7/11/2003	ORF-32-90	2" Suction w/ Flange	6.0000		184.09			
7/11/2003	PN800S	1/2" Needle Valve	2.0000		39.00			
7/11/2003	PN600S	3/8" Needle Valve	2.0000		29.40			
7/11/2003	RV1H	High Pressure Relief Valve	3.0000		83.36			
7/11/2003	20010-004	1 1/2" Single Filter Head	1.0000		19.29			
7/11/2003	OM-1220-90	3/4" Oring x 1 1/4" Suction FI	3.0000		134.82			
7/11/2003	OM-16-90	1" oring x 1" Suction Fitting	1.0000		10.95			
7/11/2003	SV3-16-0-12T-12	NC Shut Off Valve	1.0000		95.48			
8/28/2003	CTRSO 3008	3" x 8" Cylinder	2.0000		142.42			
8/28/2003	CTRSO 2006	2" x 6" Cylinder	1.0000		59.98			
8/28/2003	20032-009	V10 Pump LH Splined Shaft 7GPM	1.0000		168.00			
8/28/2003	CTRSO 3006	3" x 6" Cylinder	1.0000		73.00			
8/28/2003	CTRSO 3012	3" x 12" Cylinder	1.0000		84.94			
8/28/2003	CTRSO 3024	3" x 24" Cylinder	2.0000		230.44			
8/28/2003	TRSO-2008	2" x8" Cylinder w/Extention	2.0000		128.44			
8/28/2003	CTRSO 2010	2" x 10" Cylinder	3.0000		206.07			
8/28/2003	CTRSO 2012	2" x 12" Cylinder	2.0000		139.82			
8/28/2003	18638C	16" Steering Cylinder	4.0000		568.50			
8/28/2003	20010-009	PVE21L Pump	1.0000		459.11			
8/28/2003	20004-004	Inline Filter	1.0000		87.51			
8/28/2003	20007-012	Steering Motor	1.0000		345.34			

10:53 AM

Lenco Products Inc Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
8/28/2003	DT-S-0155	Brake Charge Pressure Valve	1.0000		214.27			
8/28/2003	MV5-14A-12TD	Valve Section	6.0000		902.58			
8/28/2003	20022-001	Ultrasonic Analog Sensor	1.0000		368.67			
8/28/2003	20024-009	Cassappa 20 cu Pump	1.0000		388.00			
8/28/2003	20008-012	Steering Motor - Coulumn Adapt	1.0000		32.50			
8/28/2003	20011-012	Trash Fan Motor	1.0000		216.00			
8/28/2003	20018-012	18.7 cu "S" Series Motor	9.0000		2,074.32			
8/28/2003	20002-012	Char-Lynn Motor	1.0000		238.38			
8/28/2003	MS18-20	MS18 plus 20 Wheel Motor	2.0000		5,917.08			
8/28/2003	MS83	MS83 Wheel Motor	2.0000		27,456.10			
8/28/2003	CDC-0127	Aluminum Manifold	1.0000		134.00			
8/28/2003	CDC-0126	Aluminum Manifold	4.0000		310.00			
8/28/2003	20020-001	Iqan Can-Bus	1.0000		838.75			
8/28/2003	02-136316	Air Head Timer Valve	1.0000		88.04			
8/28/2003	20004-013	3 Bank Pulsar Valve	1.0000		1,268.33			
8/28/2003	MV5-14-12TD	Single Valve Bank Section w/co	1.0000		100.10			
8/28/2003	SV4-10-C-6T-12	N.C. Solenoid Valve	1.0000		47.08			
8/28/2003	1303-1.6	1.6 GPM Vonberg Flow Control (	2.0000		44.38			
8/28/2003	MV4-15A-12TD	Cylinder Valve (Rear Steering)	1.0000		167.75			
8/28/2003	CRV5-10-S-8T-2	Crossover relief	1.0000		97.24			
8/28/2003	MV5-4BK	Bolt Kit for 4 bank MV5	4.0000		34.00			
8/28/2003	MV5-3BK	Bolt Kit for 3 Bank MV5	1.0000		7.43			
8/28/2003	MV5-SC	MV5 Valve Bank Outlet Side	2.0000		14.86			
8/28/2003	MV5-SI	MV5 Valve Bank Inlet Section	2.0000		13.76			
8/28/2003	20021-001	Inclinometer (SSYO195)	1.0000		240.16			
8/28/2003	12PH	MS-18 3/4" Split Flange	4.0000		15.80			
8/28/2003	RV5-10-S-8T-3/1	100# Relief Block	2.0000		102.00			
8/28/2003	CS11RDE	Reversing Valve	3.0000		1,362.79			
8/28/2003	RLTVZ10S20D5	In Line Filter/Pull Type Windr	2.0000		313.00			
8/28/2003	DT-S-6200	2" x 32T Keyed Coupling	2.0000		119.76			
8/28/2003	20022-009	64 Hydro w/elec control RH Ser	1.0000		2,608.88			
8/28/2003	20009-012	Splined Arthead Motor	1.0000		1,201.56			
8/28/2003	20025-009	Single 3.0 Electronic Pump	1.0000		1,431.08			
8/28/2003	SV4-10-0-6T-12D	N.O. Solenoid Valve	2.0000		97.68			
8/28/2003	20005-012	VIS Motor	2.0000		3,088.86			
8/28/2003	DT-S-4276	Ground Drive Flow Divider Bloc	1.0000		829.48			
8/28/2003	63TF 16x20	45" flange fitting	4.0000		72.64			
8/28/2003	20PH	1 1/4" Split Flange	4.0000		42.10			
8/28/2003	DT-S-0150C	Ground Drive Manifold	1.0000		2,738.33			

10:53 AM

Lenco Products Inc Management Detail

Category	Description	Classification	Actual Units	Estimated Units	Actual Cost	Estimated Cost	Under Budget	Over Budget
8/28/2003	RV1H	High Pressure Relief Valve	2.0000		55.57			
8/28/2003	20017-012	8 cu "S" Series Motor	1.0000		193.63			
8/28/2003	20030-009	Cassappa Dual 30/30/20 Cu Pump	1.0000		825.26			
8/28/2003	20004-009	Tandem 64 Pump	1.0000		4,388.62			
8/28/2003	BVUM-2500N	2 1/2" Ball Valve	1.0000		57.55			
8/28/2003	RDRS175-16	16 Gal Flow Control w/relief	4.0000		214.37			
8/28/2003	20007-010	Esckridge Gear Box - Series 28	1.0000		729.30			
8/28/2003	20003-010	Airhead Gear Box	1.0000		1,135.00			
8/28/2003	20002-004	In-Tank Filter Assembly	3.0000		438.60			
8/28/2003	20028-009	Tandem 3.0 Electronic Pump	1.0000		2,860.26			
8/28/2003	20015-011	Split Flange Kit	1.0000		17.24			
8/28/2003	20014-011	Split Flange Adapter 3" port s	1.0000		70.74			
8/28/2003	20029-009	35VQT Vane Pump	1.0000		828.00			
8/28/2003	FD00181800	White Flow Divider	1.0000		323.51			
8/28/2003	RDRS112-30	30 Gal Flow Control w/relief	9.0000		459.32			
8/28/2003	20004-010	4 Hole Gear Box	1.0000		3,463.85			
8/28/2003	DTS-0373B	Four Bank Circuit Control Valv	2.0000		1,968.00			
8/28/2003	FP55-3/4NPT	FLOW DIVIDER	1.0000		98.07			
8/28/2003	20000-010	Auburn Gear Box	2.0000		991.00			
8/28/2003	20003-012	Char-Lynn Motor	2.0000		541.72			
8/28/2003	20003-014	Hyd Oil Cool	1.0000		1,553.66			
8/28/2003	112-1059	11 Cu 17T Eaton Motor	1.0000		499.96			
8/28/2003	20000-012	Char-Lynn Motor	10.0000		2,411.18			
Category/Class Total:			3,030.2300	.0000	96,392.81	.00		96,392.81

MA-ROLL Rollers & Sprockets

8/27/2003	BTNN 5/8	5/8"-11 Hex Nut	2.0000		.13			
8/27/2003	BTNN 5/8x3 1/2	5/8"-11 x 3 1/2" HHCS Bolt	73.0000		32.85			
8/27/2003	BTNN 5/8x5 1/2	5/8"-11 x 5 1/2" HHCS	12.0000		10.61			
8/27/2003	BTNN 5/8x7	5/8"-11 x 7" HHCS	3.0000		3.11			
8/27/2003	BTNN 5/8x5	5/8"-11 x 5" HHCS Bolt	2.0000		1.48			
8/27/2003	BTNN 5/8x9	5/8"-11 x 9" HHCS	5.0000		9.45			
8/27/2003	BTNN 5/8x4	5/8"-11 x 4" HHCS Bolt	4.0000		1.80			
8/27/2003	BTNN 1/2x4	1/2"-13 x 4" HHCS	38.0000		12.66			
8/27/2003	BTNN 1/2x7 1/2	1/2" x 7 1/2" HHCS	3.0000		2.28			
8/27/2003	BTNN 1/2x3	1/2"-13 x 3" HHCS	8.0000		1.65			
8/27/2003	25040-019	50mm 14 Tooth 2" Bore 1/2" Cha	8.0000		328.48			
8/27/2003	BTTR 5/8C	5/8"-11 Course Threaded Rod	2.0000		2.12			
8/27/2003	BTNN 1/2x3 1/2	1/2"-13 x 3 1/2" HHCS	12.0000		3.60			

Lenco Products Inc.
5773 Crystal Rd.
Vestaburg, MI 48891
Phone: (989) 268-5083
Fax: (989) 268-5820

Machine: ____AIR HEAD

Document #: _____


Customer: __DOWNEY

DELIVERY REPORT

Date: ____7-4-03

Problem:

- 1 ADD RUBBER TO BULK LOADER TO FILL IN THE GAP
- 2 BE SURE AND COLLECT ALL BOLTS AND PIECES IN A PAIL WHEN TEAR DOWN WE WERE SHORT A LOT OF BOLTS
- 3 MISSED TWO ROLLERS ON THE BULK LOADER
- 4 DRIVE CHAIN ON BULK LOADER MISSING
- 5 MISSING FILTER AND TEST PACKAGE
- 6 DEPTH CONTROL NOT THERE NEED TWO LETS PUT THE OLD STYLE BACK ON IN THE FRAME DEPT
- 7 FUEL GUAGE DOSENT WORK
- 8 ALL IN ALL THE MACHINE WAS IN EXCELENT CONDITION AND THE CUSTOMER IS VERY MUCH PLEASE NOT SURE ABOUT THE SONIC CONTROL IN THE BIN WHEN I RUNN THE ENGINE WIDE OPEN IT RAISED ALL THE WAY UP WE WILL NEED TO GET KEVIN INVOLVED ON HEARTLANDS

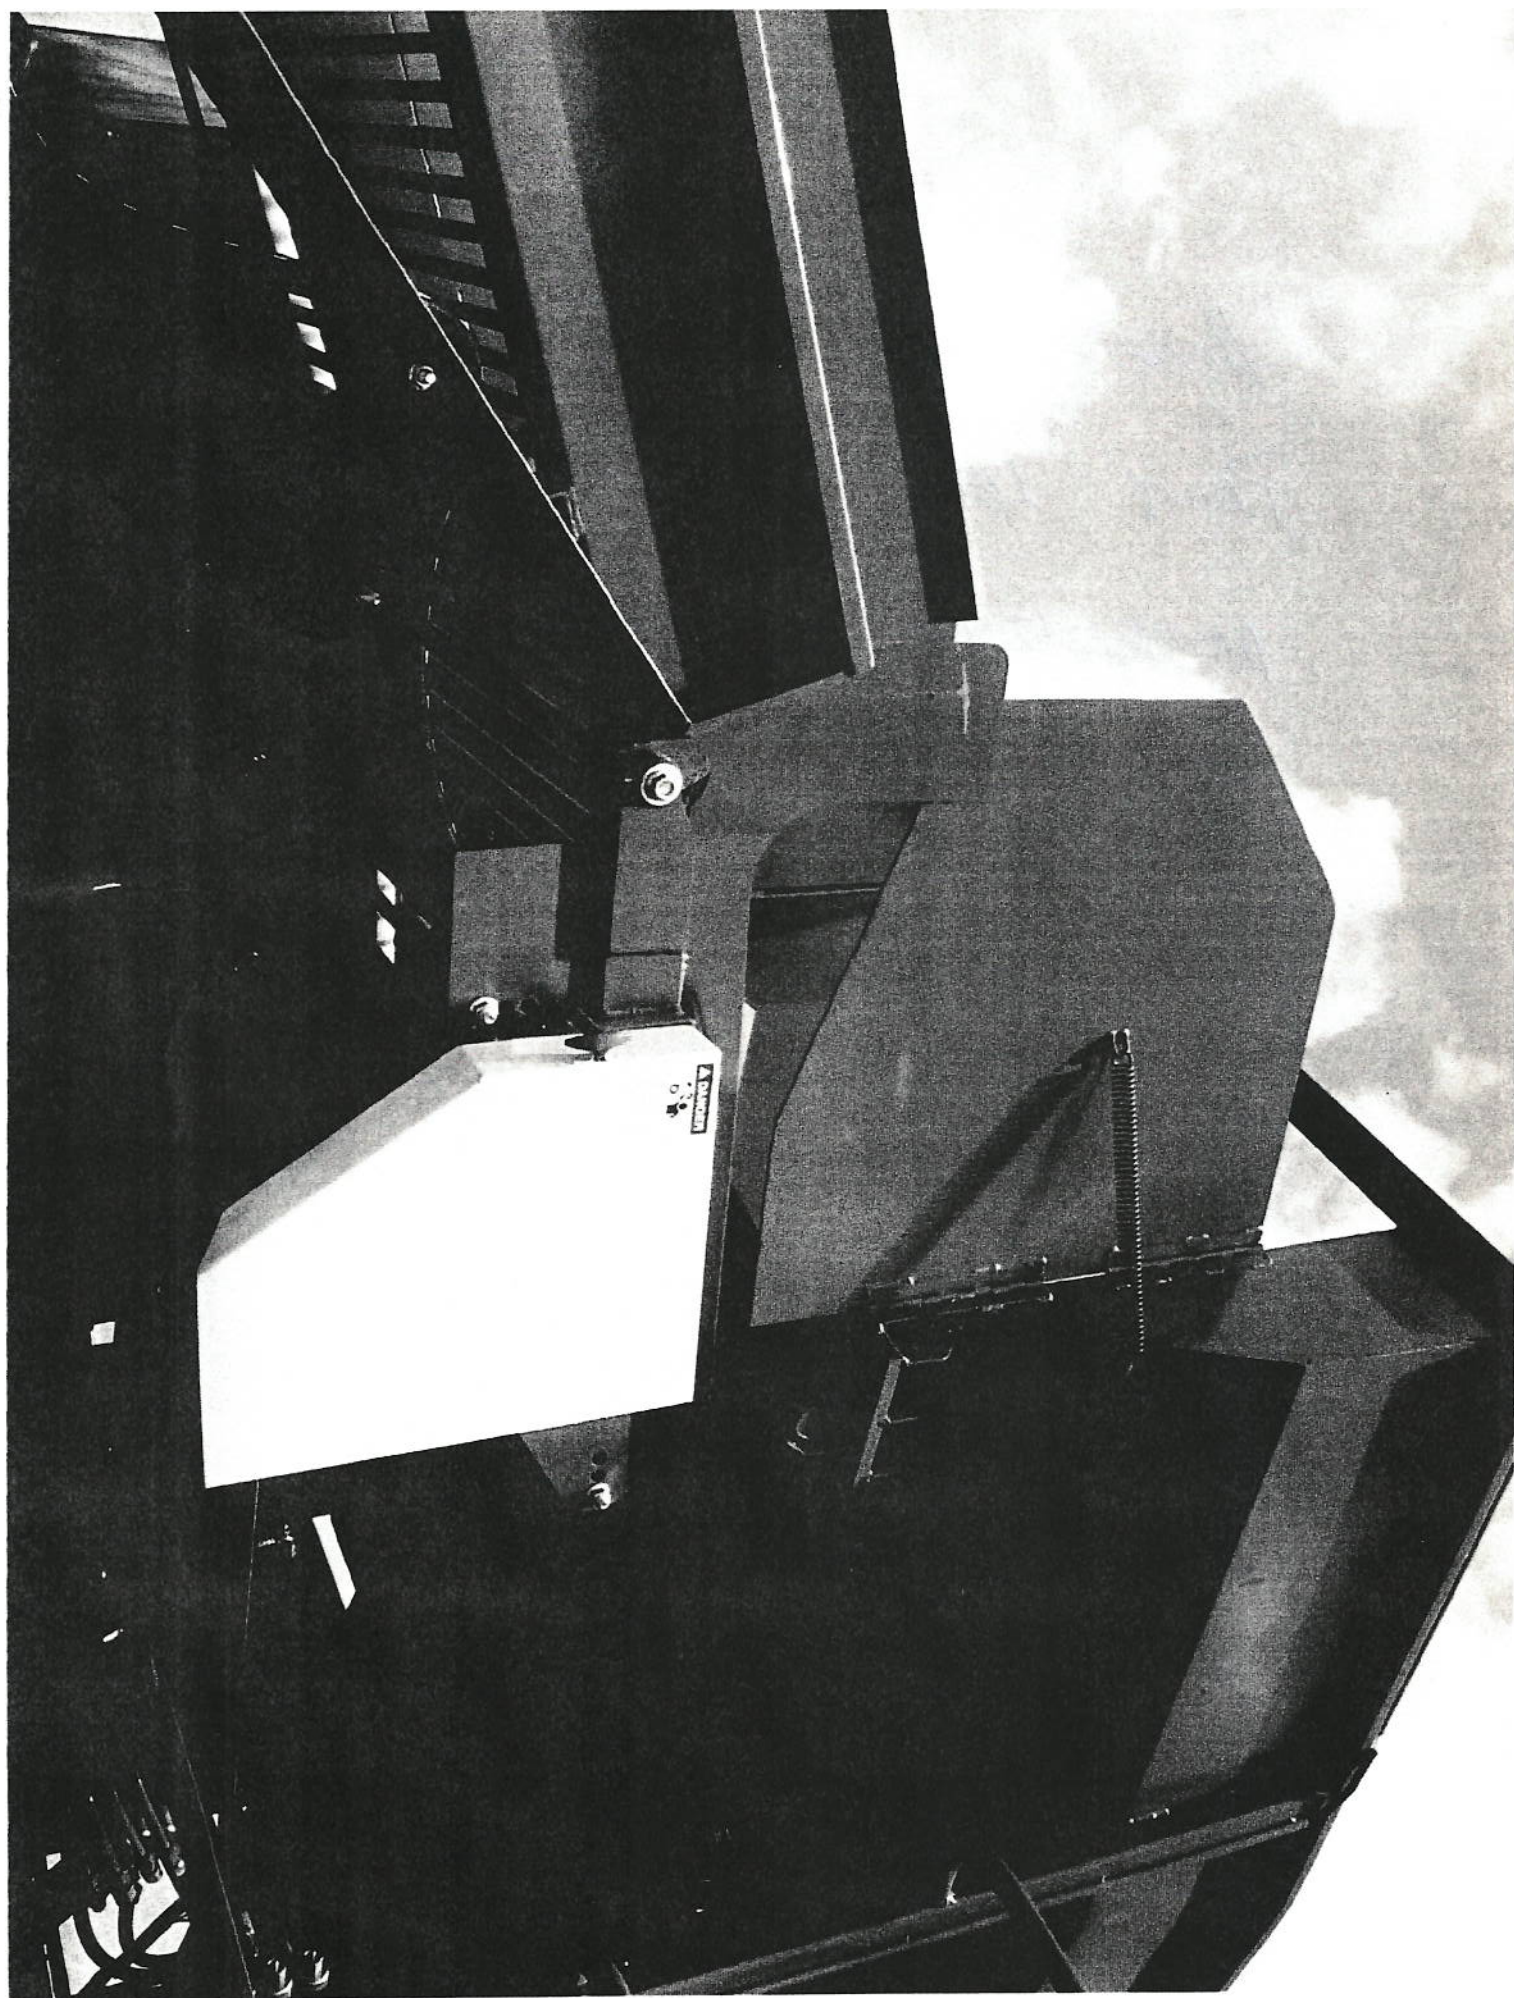

03210 Downey 4RSP65AH Harvester			
100037	3/8" Steel Line Clamp	65.0000	
100050	1/2" Steel Line Clamp	9.0000	
100050	1/2" Steel Line Clamp	58.0000	
100062	5/8" Steel Line Clamp	28.0000	
100087	7/8" Steel Line Clamp	106.0000	
100100	1" Steel Line Clamp	16.0000	
100225	2 1/4" Steel Line Clamp	4.0000	
113120	Hydrazorb Channel	63.0000	
2406 16-20	1" x 1 1/4" JIC Increaser	1.0000	
30001-014	Back Up Lights Bracket	1.0000	
30001-019	Flow Divider Plate	1.0000	
30002-019	DTS-0373 Bracket	2.0000	
30004-019	DTS-0150 Bracket	1.0000	
30009-019	RDRS 112 Mounting Bracket	11.0000	
30009-022	High Pressure Fairey Filter Br	2.0000	
30010-019	TA1919 Control Arm Left	1.0000	
30012-019	CRV5 Bracket	1.0000	
30015-019	Airhead Cleaner Valve Bracket	2.0000	
30018-019	Double Filter Head Mounting Br	1.0000	
30019-019	2 Section Valve Bank Bracket	1.0000	
30021-019	4 Section Valve Bank	1.0000	
30024-014	Fuel Filter Bracket	1.0000	
30027-019	RDRS 112 Star Roll Mounting Br	6.0000	
30028-019	Reversing Valve Mounting Brack	3.0000	
30031-019	Fuel Pump Bracket	1.0000	
30034-015	Battery Box	1.0000	
30034-019	MV4 Mounting Bracket	1.0000	
30040-019	MCV2 Mounting Bracket	1.0000	
40001-019	Hooded Valve Bank Assy	1.0000	
40015-018	Steering Block Assy	1.0000	
6402 12-12	3/4" Oring x 3/4" JIC female	4.0000	
6402 20x20	1 1/4" Oring x 1 1/4" JIC Fema	1.0000	
6505 12-12	3/4" NPT x 3/4" JIC female	2.0000	
848FS 06x06	3/8" JIC x 3/8" NPT	2.0000	
848FS 12x12	3/4" JIC x 3/4" NPT	4.0000	
848FSO 12x20	3/4" JIC x 1 1/4" Oring	2.0000	
851FSO 12	3/4" JIC x 3/4" Oring Tee	6.0000	
871FS 12	3/4" JIC x 3/4" JIC Swivel Tee	2.0000	
872FS 12	3/4" JIC x 3/4" JIC Swivel Tee	1.0000	
ABAX1000-06	3/8" JIC x 3/8" Tube	20.0000	
ABAX1000-08	1/2" JIC x 1/2" Tube	39.0000	
ABAX1000-10	5/8" JIC x 5/8" Tube	8.0000	
ABAX1000-14-12	3/4" JIC x 7/8" Tube	45.0000	
ABAX1000-14-12	3/4" JIC x 7/8" Tube	26.0000	
ABAX1000-16	1" JIC x 1" Tube	8.0000	
BAX1100 06	3/8" NPT Female x 3/8" Tube	4.0000	
BAX1100 10	1/2" NPT Female x 5/8" Tube	4.0000	
BAX1100 14	3/4" NPT Female x 7/8" Tube	1.0000	
BAX1200 08	1/2" Tube Union	4.0000	
BAX1200 08	1/2" Tube Union	4.0000	
BAX1200 10	5/8" Tube Union	4.0000	

BAX1200 14	7/8" Tube Union	10.0000		
BAX1200 16	1" Tube Union	2.0000		
BAX3100 08	1/2" NPT x 1/2" Tube Tee	2.0000		
BAX3100 10	1/2" NPT x 5/8" Tube Tee	1.0000		
BAX3100 14	3/4" NPT x 7/8" Tube Tee	2.0000		
DTS-0155	Brake Charge Pressure Valve	1.0000		
EMT050	1/2" EMT Conduit	72.5000		
EMT075	3/4" EMT Conduit	98.6700		
FP55-3/4NPT	FLOW DIVIDER	1.0000		
HYDTB 06	3/8" Hydraulic Tubing	162.5800		
HYDTB 08	1/2" Hydraulic Tubing	184.9200		
HYDTB 08	1/2" Hydraulic Tubing	11.2500		
HYDTB 10	5/8" Hydraulic Tubing	70.1700		
HYDTB 10	5/8" Hydraulic Tubing	15.0800		
HYDTB 14	7/8" Hydraulic Tubing	348.5000		
HYDTB 14H	7/8" High Pressure Hydraulic T	20.3300		
HYDTB 14H	7/8" High Pressure Hydraulic T	54.8300		
HYDTB 16	1" Hydraulic Tubing	97.0800		
RDRS112-30	30 Gal Flow Control w/relief	7.0000		